

W-63


Silicone

Self-Adhesive Gasket Installation Instructions

KNC

100 ft

200 ft

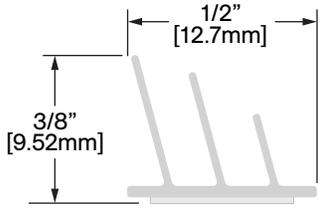

Note: Adhesive seals have a limited shelf life. Products should be installed as soon as possible.

Preparation

Frame must be clean, dry and free of dust, oil, grease, etc. Clean with alcohol wipe or suitable cleaner that does not leave residue. Paint must be dry/cured. High gloss finishes may require scuffing with Scotchbrite pad to facilitate proper adhesion.

Note: Some frame manufacturers apply light wax to hollow metal frames. Remove wax with appropriate wax remover. Frame must be above 10°C or 50°F.



Installation

1. Measure and pre-cut gasket to suit head and jamb lengths. Do not apply in one continuous piece.
2. Remove protective backing 12-24" at a time, and apply gasket according to illustrations.

Latch side jamb and head: Apply to frame, per Figure A.

Hinge side jamb: Apply to strike, per Figure B.

3. Repositioning is not recommended, but if required should be done immediately: Gently remove gasket, reposition and apply pressure along the full length of the gasket. Full adhesive strength will develop over 24-48 hours.

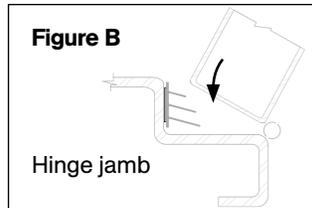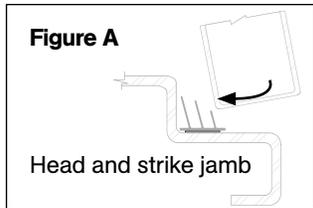

Silicone Self-Adhesive Gasket
 Smoke, light and sound control
 Unaffected by fungus and mildew
 Temperature range: -110°F to +400°F (-80°C to +204°C)
 Provides little resistance to door closing devices
 Adhesive shelf life, when stored at room temperature, 6 months.
 Applications with 90 minute wood veneered steel frames.


 KN CROWDER LISTED GASKETING SYSTEM
 Weatherstrip / Threshold / Auto Door Bottom / Astragal
 CERTIFIED TO: CAN/ULC S104 NFPA525 UL10B
 W/N 18031 See Intertek's directory of Building Products for information.




Intertek's directory of Building Products

W-63


Silicone

Self-Adhesive Gasket Installation Instructions

KNC

100 ft

200 ft

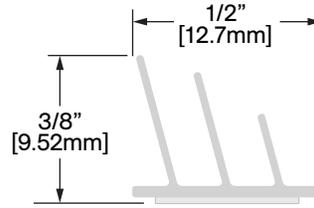

Note: Adhesive seals have a limited shelf life. Products should be installed as soon as possible.

Preparation

Frame must be clean, dry and free of dust, oil, grease, etc. Clean with alcohol wipe or suitable cleaner that does not leave residue. Paint must be dry/cured. High gloss finishes may require scuffing with Scotchbrite pad to facilitate proper adhesion.

Note: Some frame manufacturers apply light wax to hollow metal frames. Remove wax with appropriate wax remover. Frame must be above 10°C or 50°F.



Installation

1. Measure and pre-cut gasket to suit head and jamb lengths. Do not apply in one continuous piece.
2. Remove protective backing 12-24" at a time, and apply gasket according to illustrations.

Latch side jamb and head: Apply to frame, per Figure A.

Hinge side jamb: Apply to strike, per Figure B.

3. Repositioning is not recommended, but if required should be done immediately: Gently remove gasket, reposition and apply pressure along the full length of the gasket. Full adhesive strength will develop over 24-48 hours.

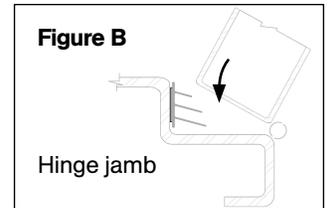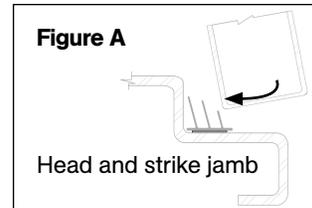

Silicone Self-Adhesive Gasket
 Smoke, light and sound control
 Unaffected by fungus and mildew
 Temperature range: -110°F to +400°F (-80°C to +204°C)
 Provides little resistance to door closing devices
 Adhesive shelf life, when stored at room temperature, 6 months.
 Applications with 90 minute wood veneered steel frames.


 KN CROWDER LISTED GASKETING SYSTEM
 Weatherstrip / Threshold / Auto Door Bottom / Astragal
 CERTIFIED TO: CAN/ULC S104 NFPA525 UL10B
 W/N 18031 See Intertek's directory of Building Products for information.




Intertek's directory of Building Products